




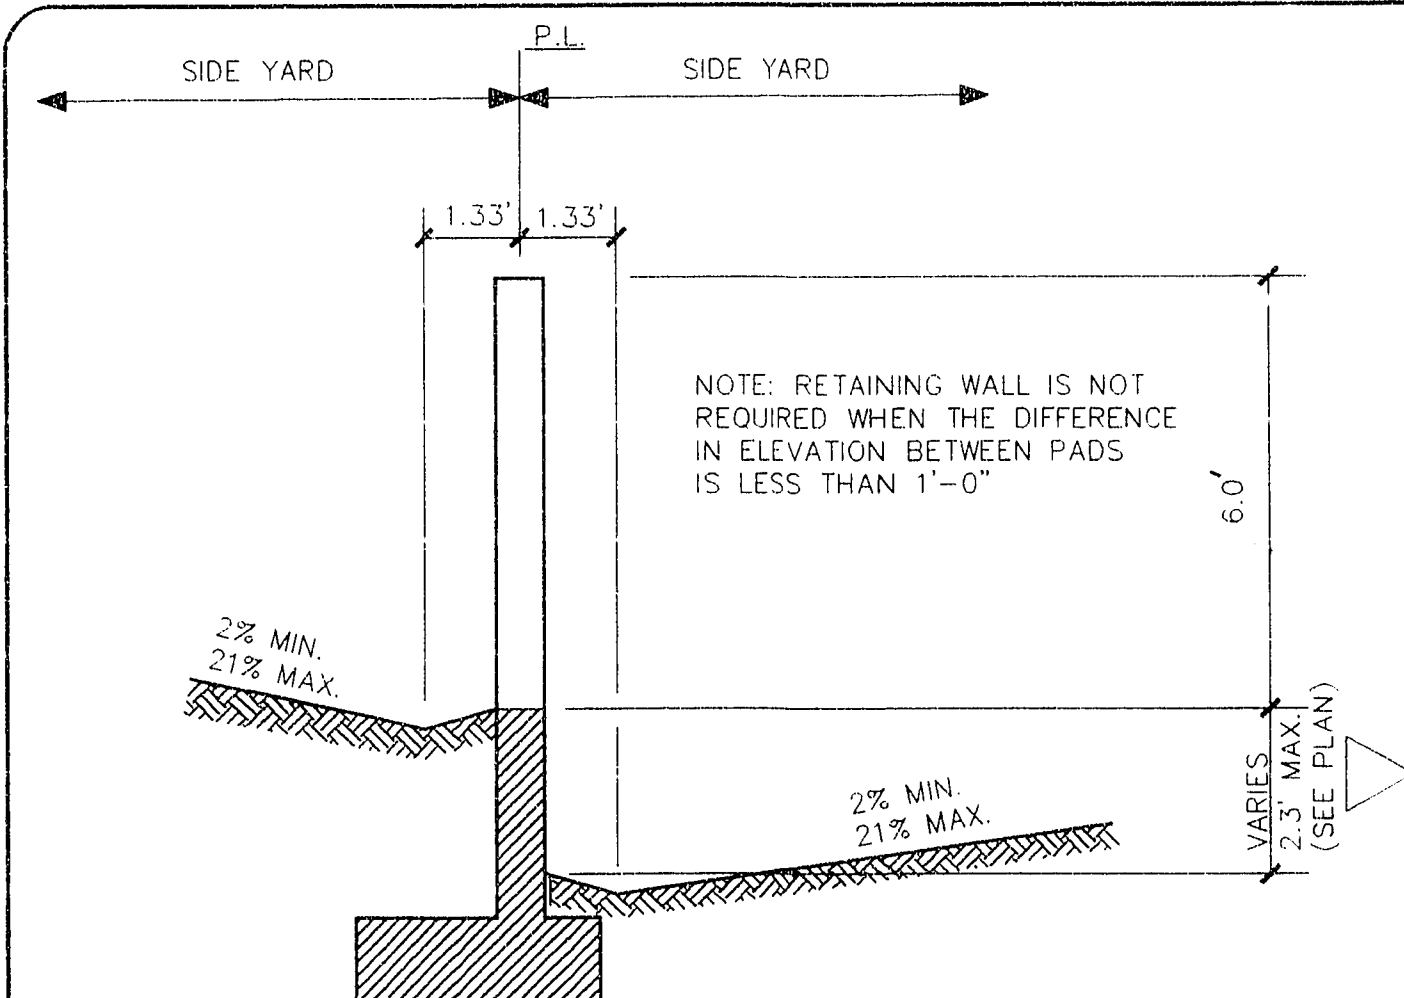

1
3 **INTERIOR SIDE RETAINING WALL**
TYPICAL SECTION
N.T.S.

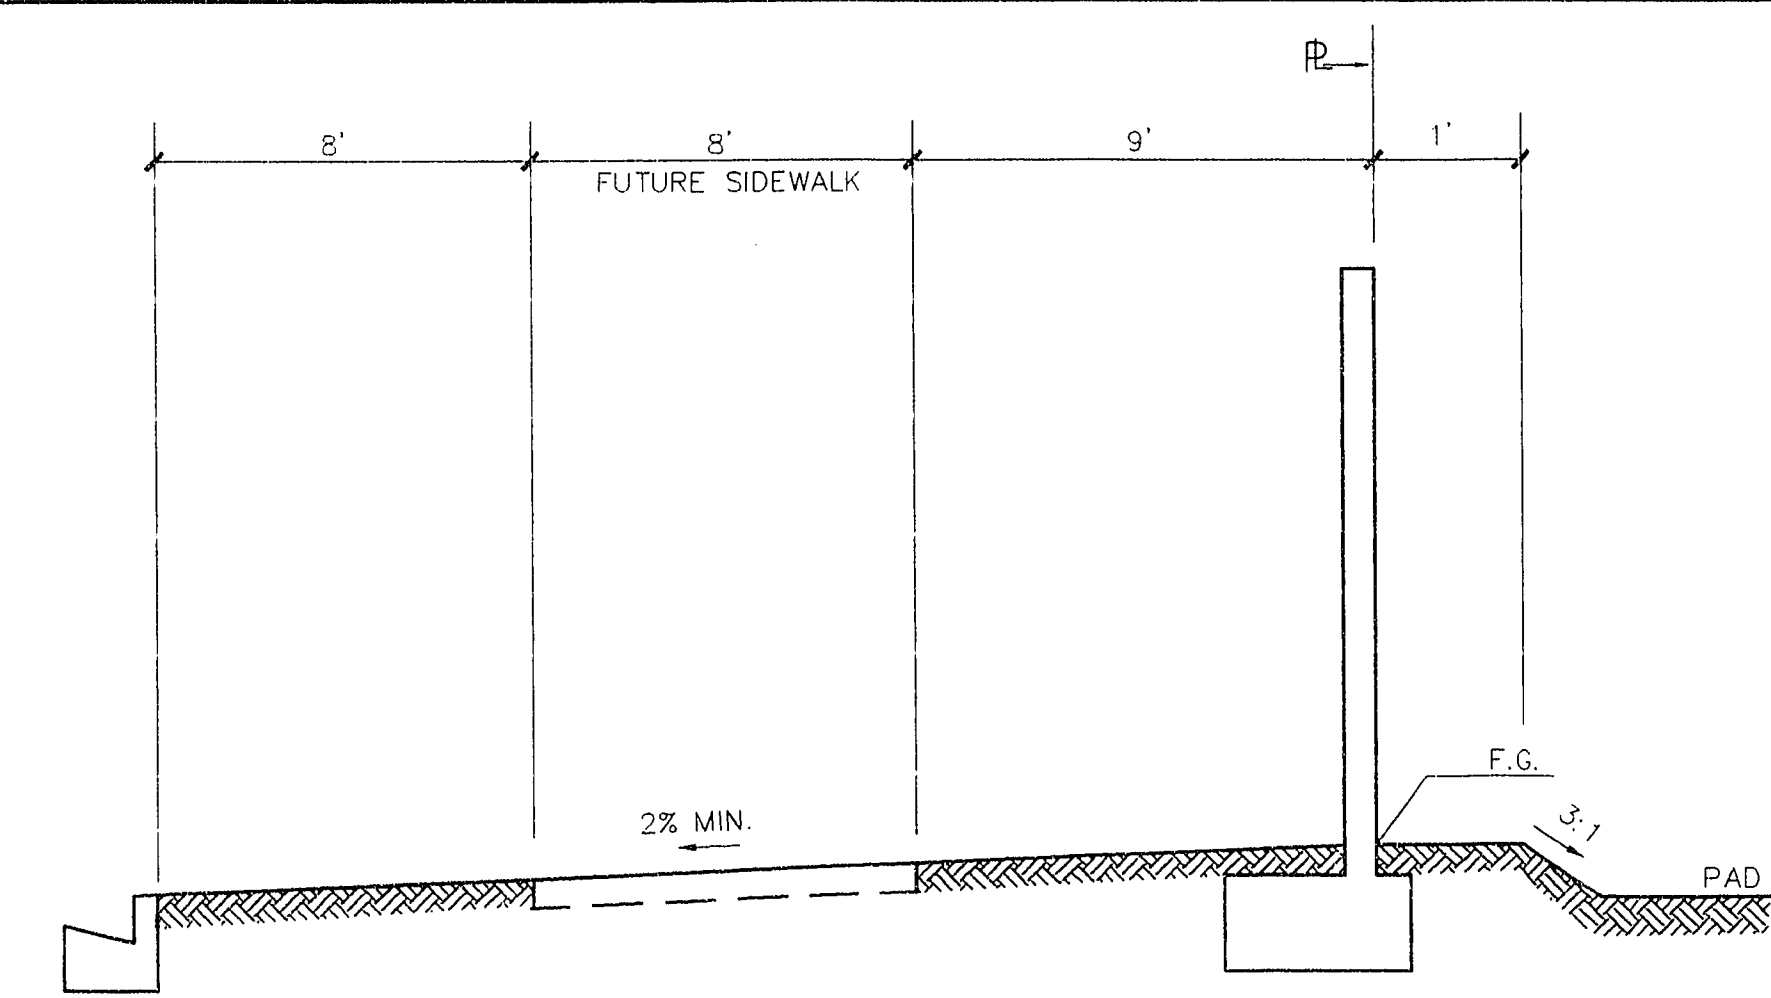


2
3 **ANASAZI DRIVE WALL**
TYPICAL SECTION
N.T.S.

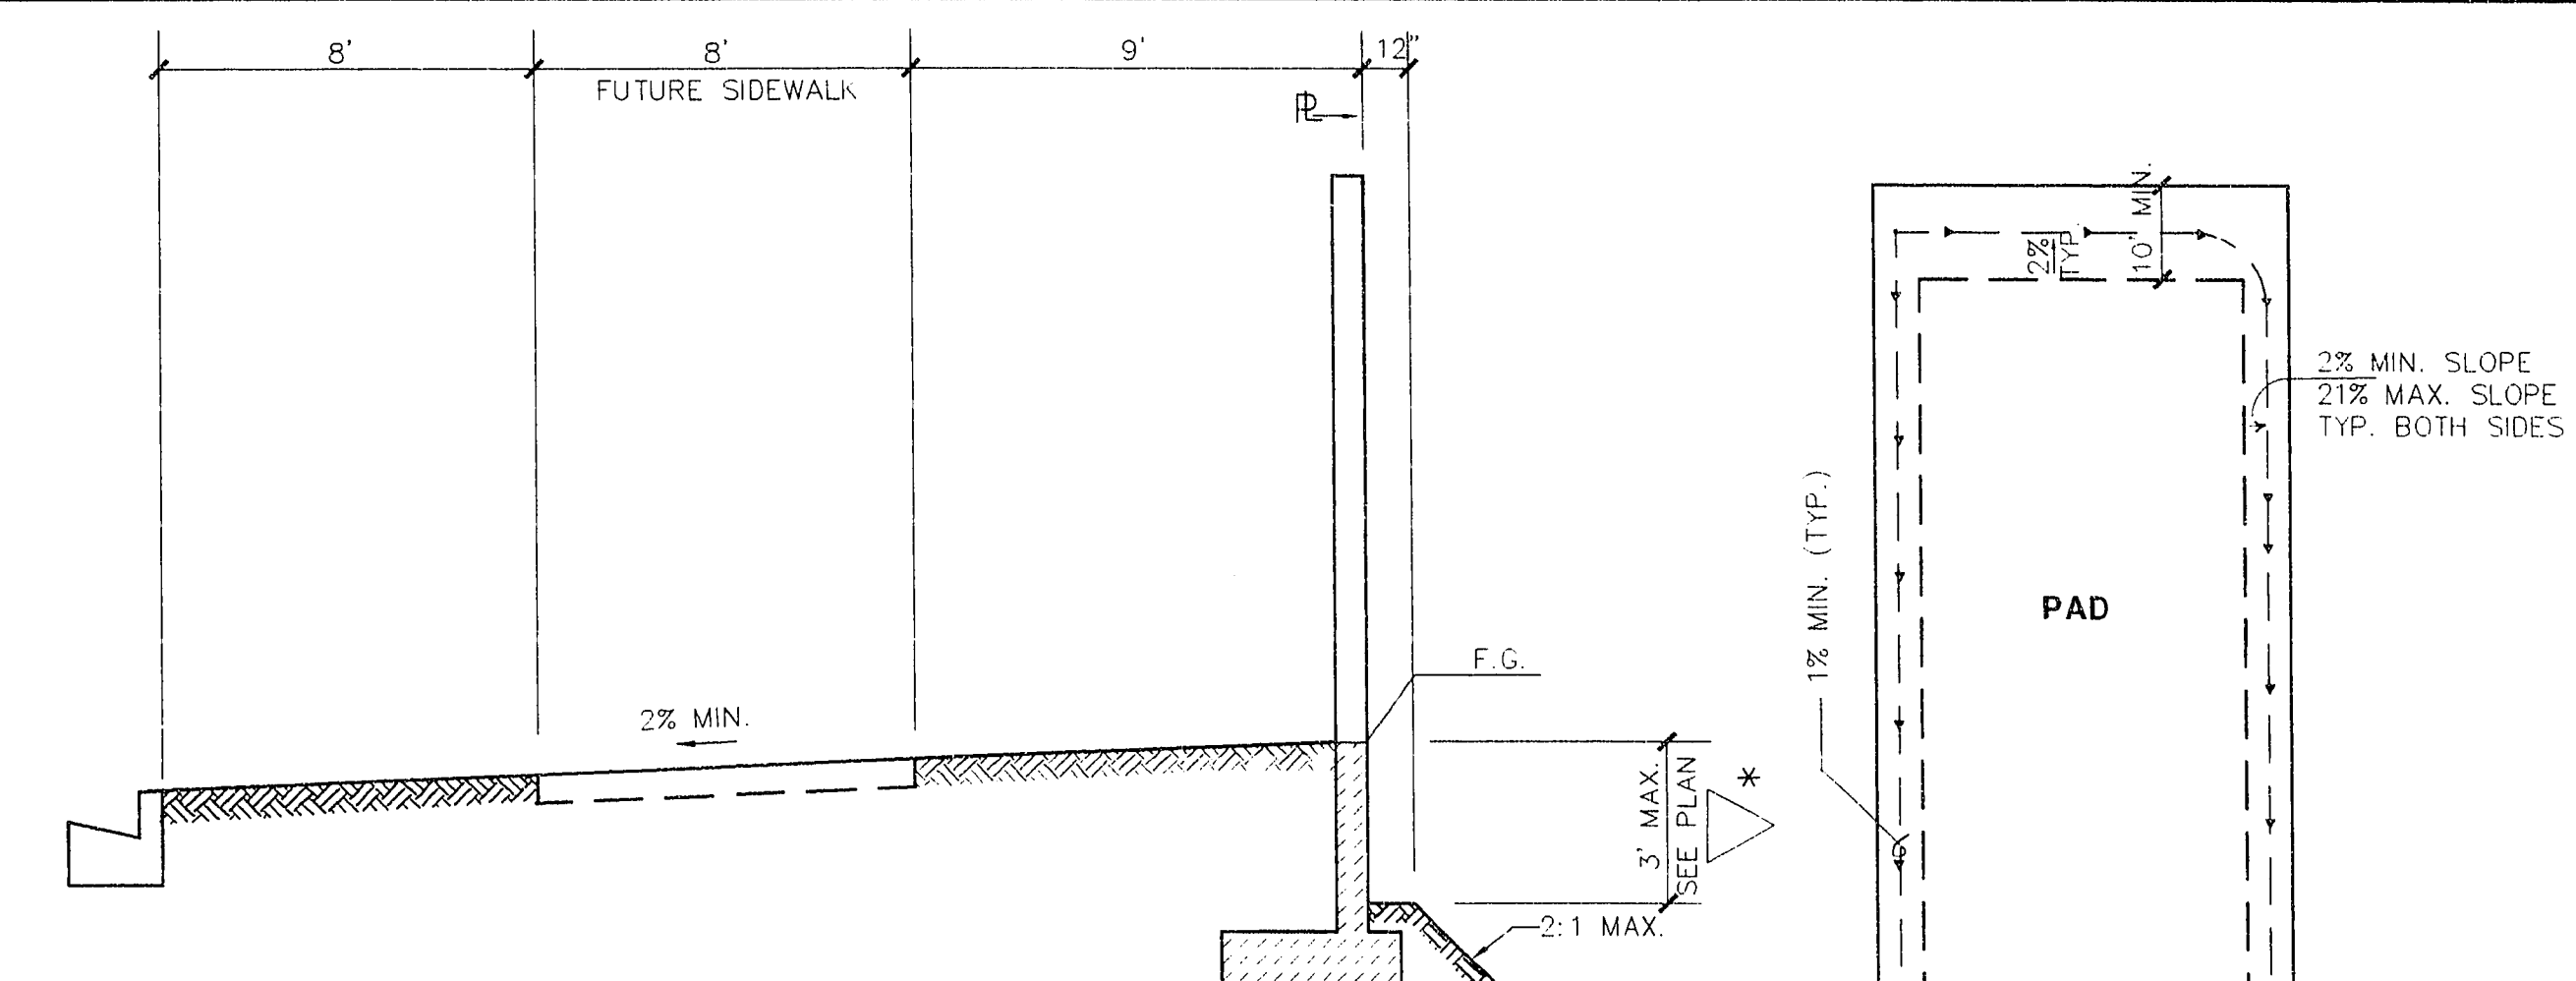


3
3 **ANASAZI DRIVE-DOUBLE**
RETAINING WALLS
TYPICAL SECTION
N.T.S.


TYPICAL GRADING
PLAN VIEW
N.T.S.

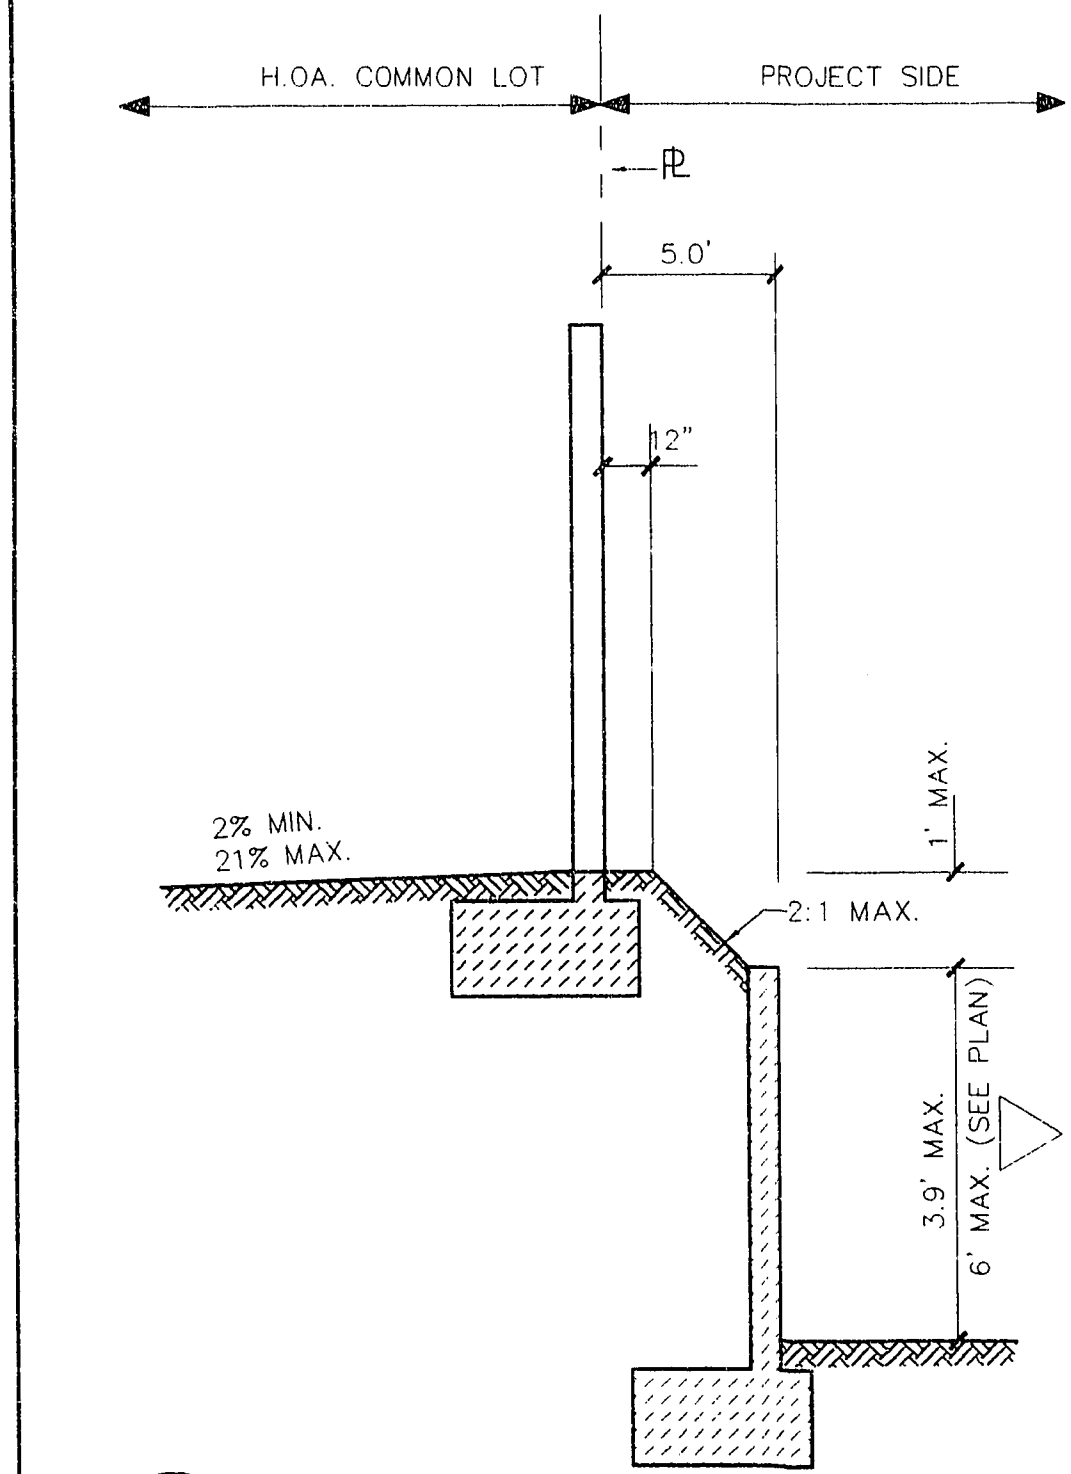


4
3 **DOUBLE RETAINING WALLS @**
TRAIL HOLLOW DRIVE (LOTS 43 AND 44)
TYPICAL SECTION
N.T.S.

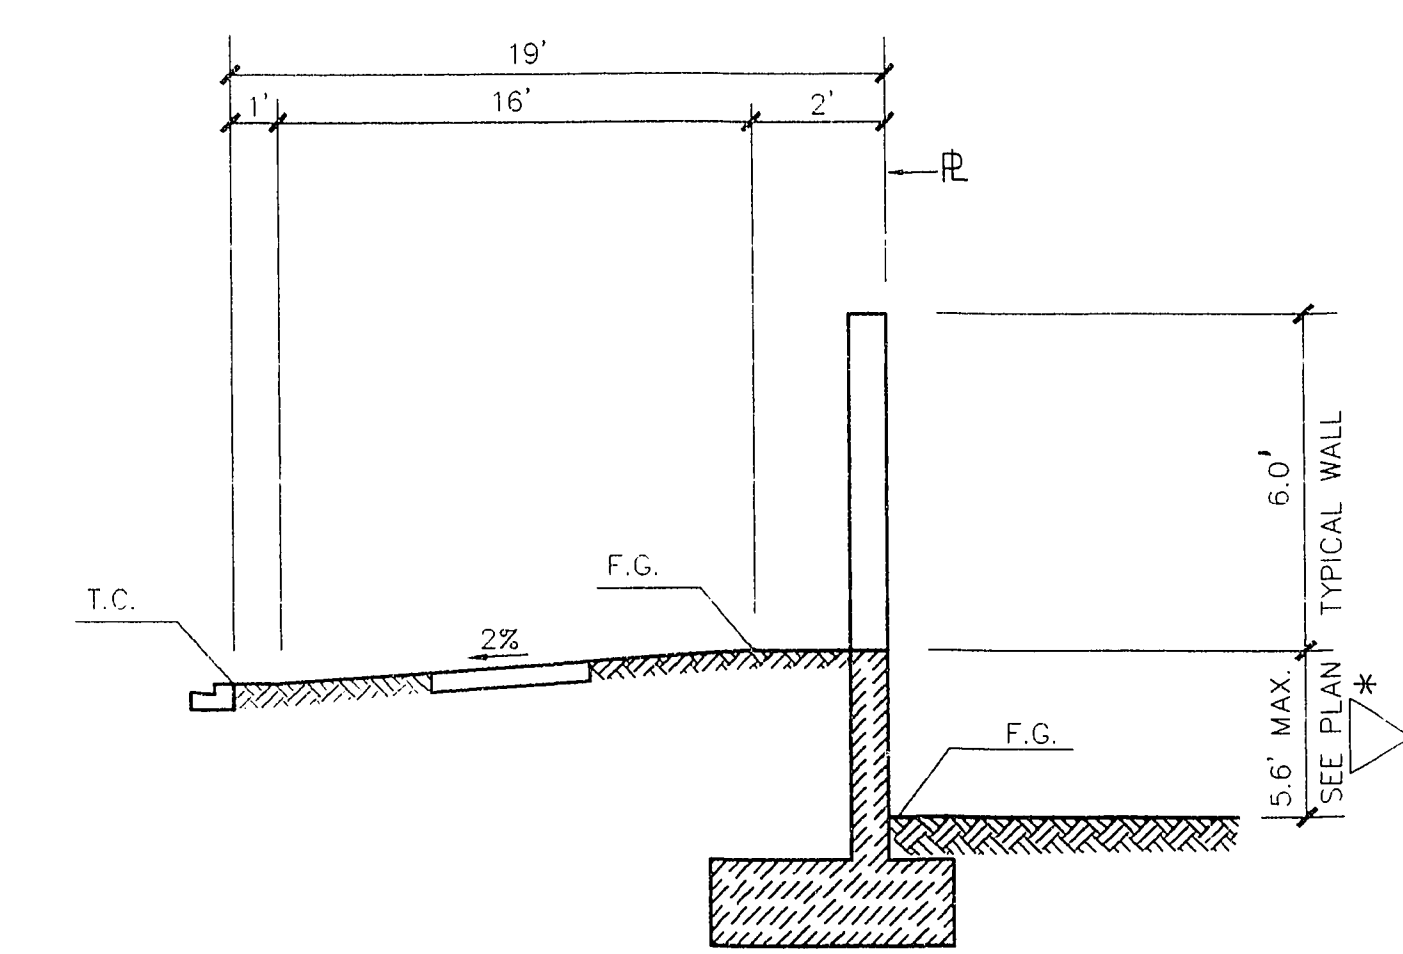


5
3 **SINGLE WALL @ TRAIL HOLLOW DRIVE**
TYPICAL SECTION
N.T.S.

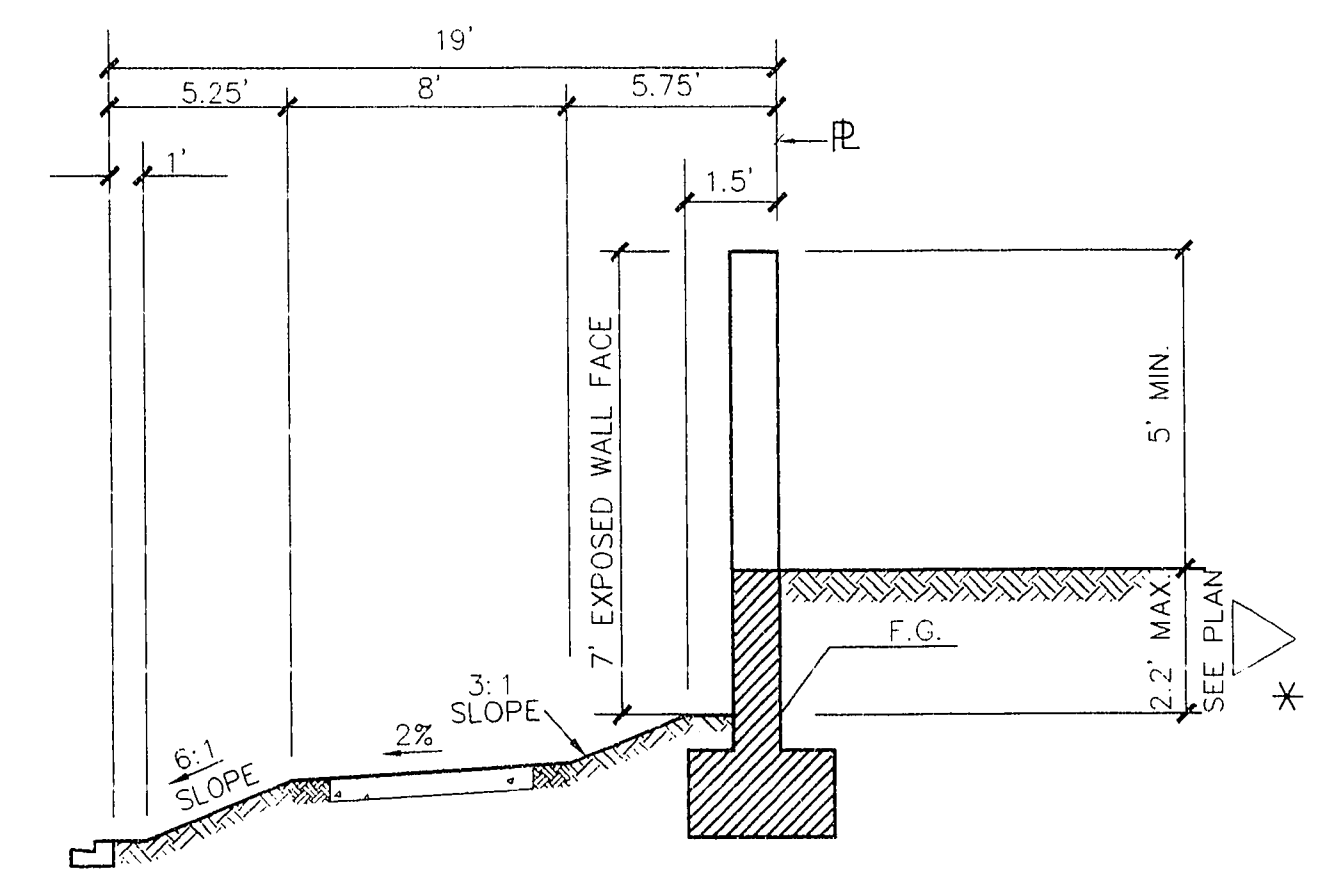


6
3 **SINGLE WALL @ TRAIL HOLLOW DRIVE**
TYPICAL SECTION
N.T.S.

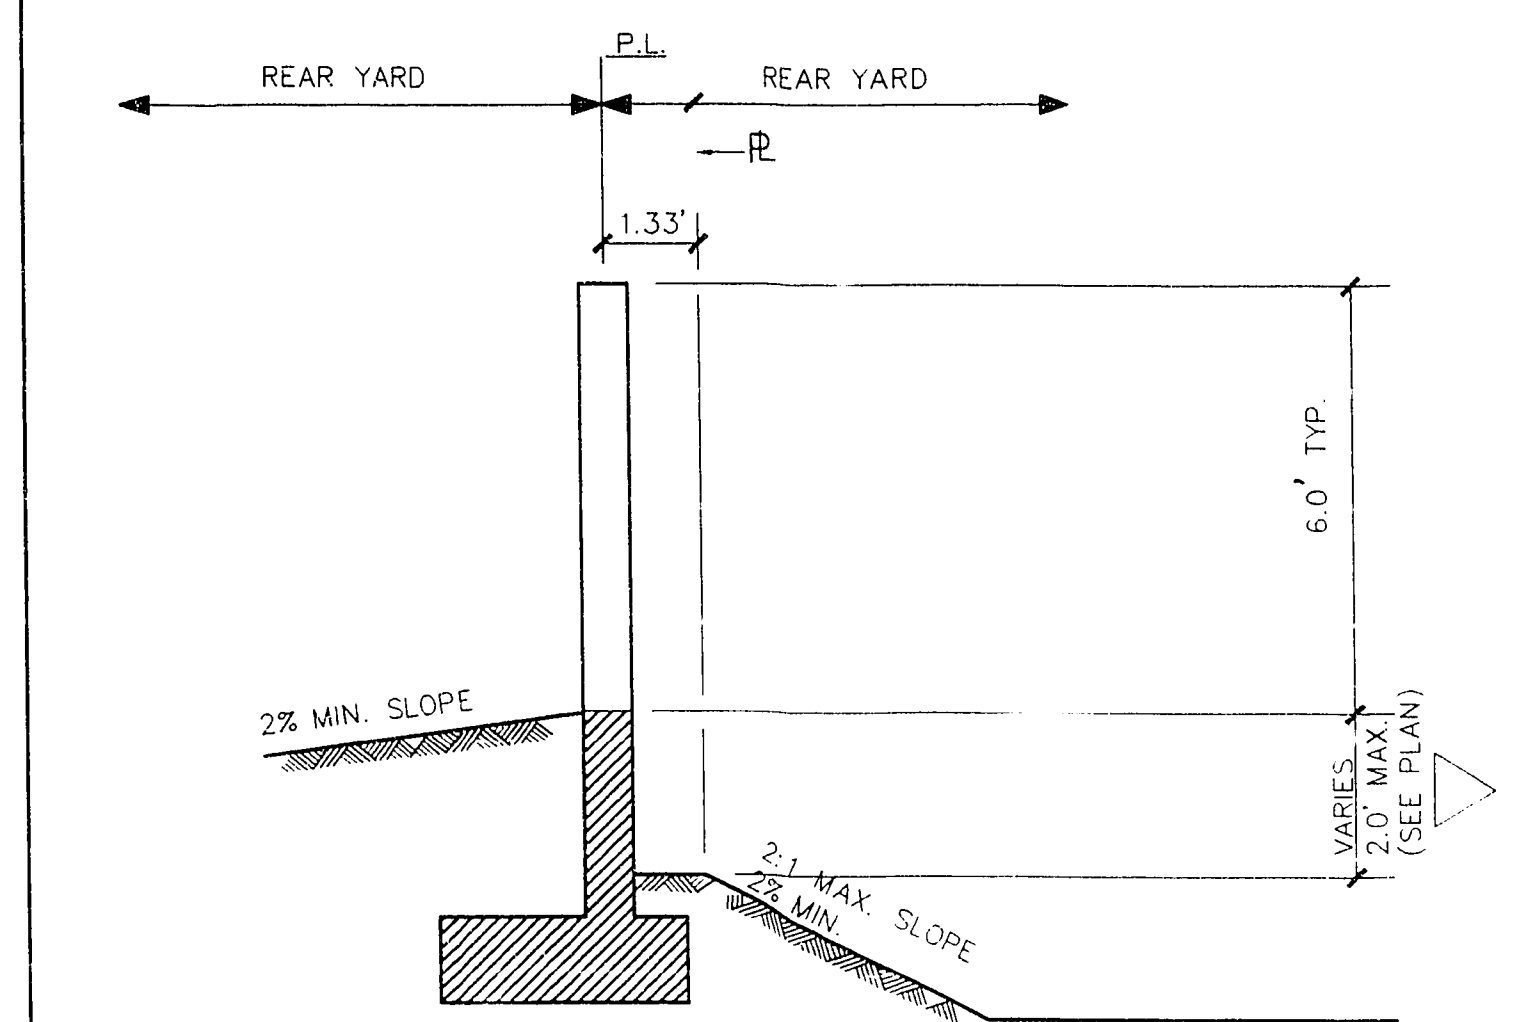


8
3 **RETAINING WALL**
TYPICAL SECTION
N.T.S.

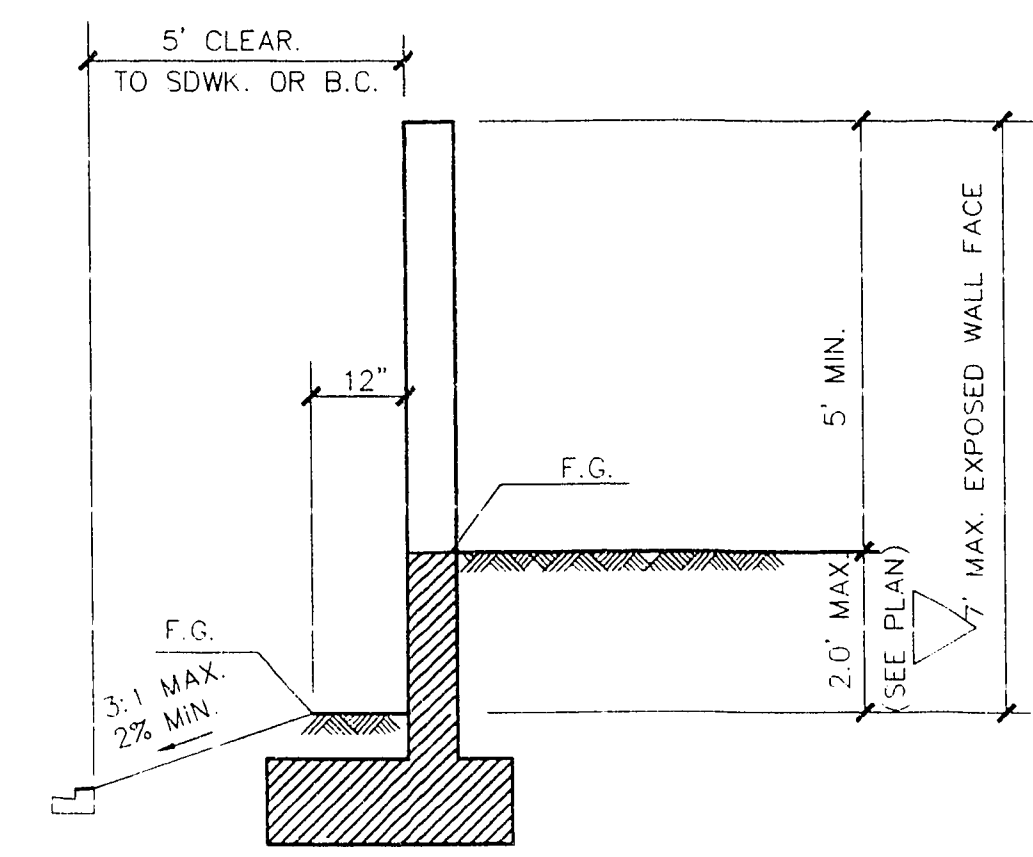


9
3 **SINGLE WALL SIDE YARD**
RETAINMENT
TYPICAL SECTION
N.T.S.

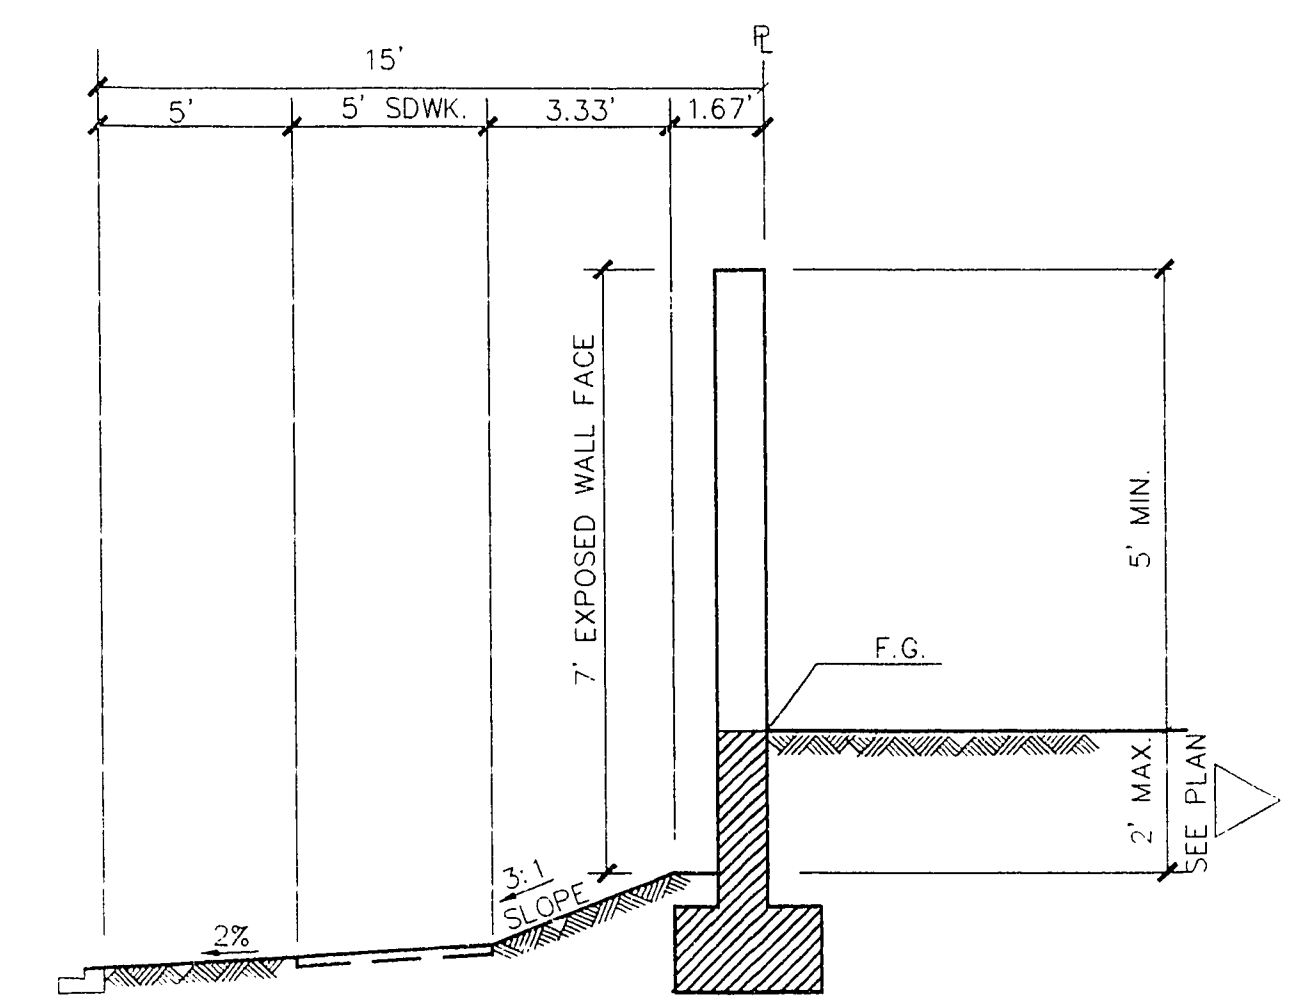

10
3 **SINGLE WALL SIDE YARD RETAINMENT**
TYPICAL SECTION AT ENTRY
N.T.S.

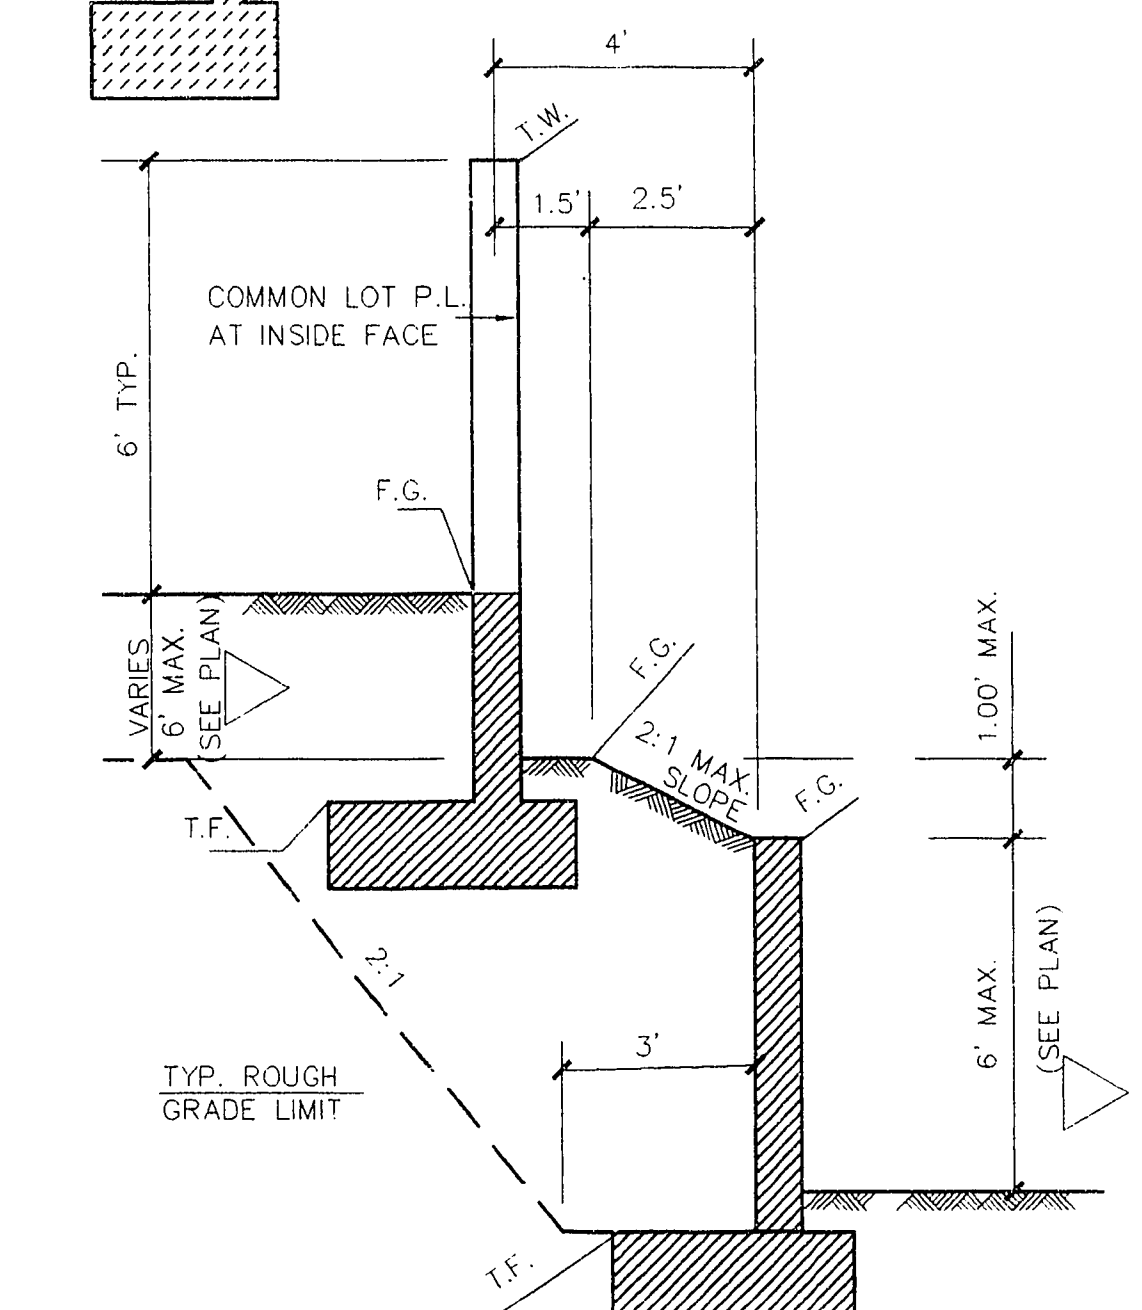

7
3 **DOUBLE RETAINING WALLS**
TYPICAL SECTION
N.T.S.

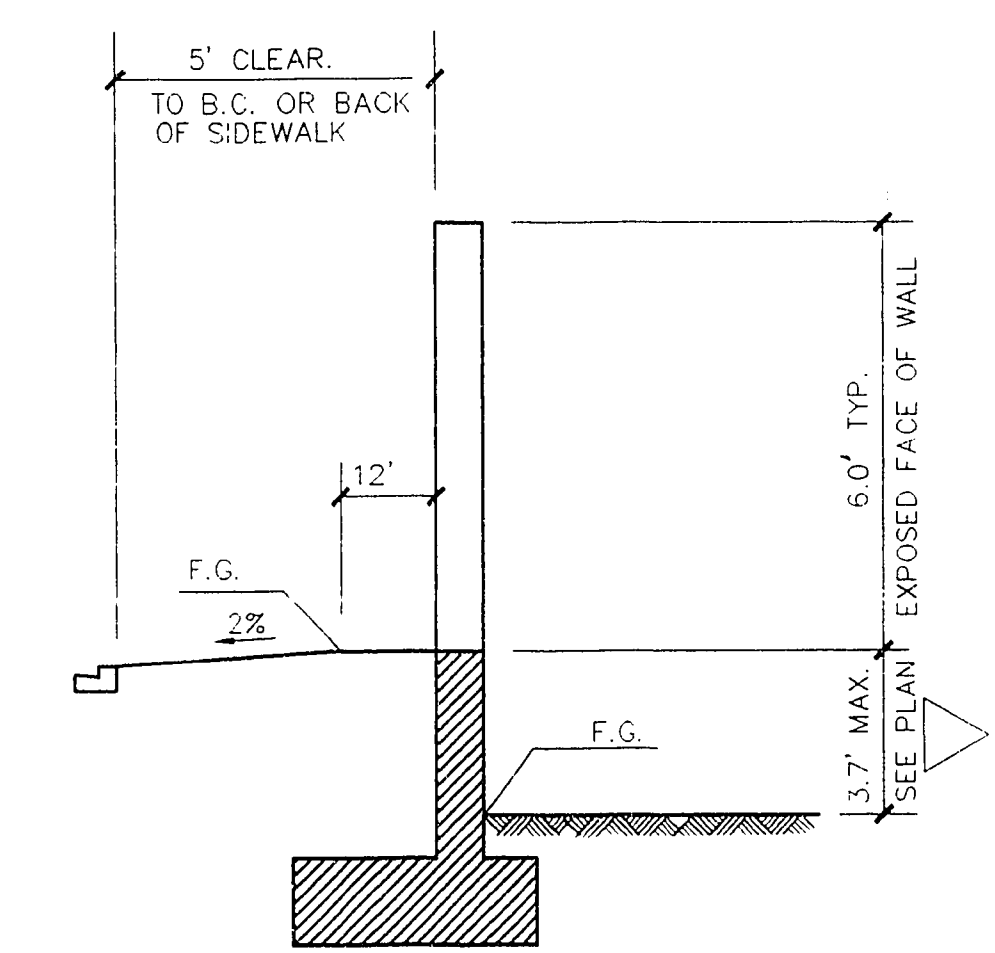

11
3 **SINGLE WALL SIDE YARD**
RETAINMENT-TYPICAL SECTION
N.T.S.

* ALL FILL MATERIAL, GRADING AND RETAINING WALLS NECESSARY WITHIN SUMMERLIN'S HOA COMMON LOT AS A RESULT OF OF THIS PARCEL DEVELOPER'S GRADING IS THIS PARCEL DEVELOPER'S COST.

PLASTER DEVELOPMENT
CITY OF LAS VEGAS

CONSULTING ENGINEERS • PLANNERS • LAND SURVEYORS
2727 SOUTH RAINBOW BOULEVARD
LAS VEGAS, NEVADA 89102-5148 PHONE (702) 873-7550 FAX (702) 362-2597

REVISION
DATE BY
REV

GRADING DETAILS

INDIAN HILLS
UNIT 4

TITLE PROJECT

SEAL
ENGINEER
CIVIL
5.9.96

WO NO. 4820-4
BY HLA
DATE JAN. 1996
SCALE HORIZ. AS SHOWN
VERT. AS SHOWN
SHEET 3 OF 5 SHEETS

11-23-15 1074-4410-4